



# SAFETY ALERT

## Swing Away Folding Jib

During transport (not on crane) a Swing Away Folding Jib opened with the tip section entering the live lane while the transporter was traveling at 90Km/Hr.

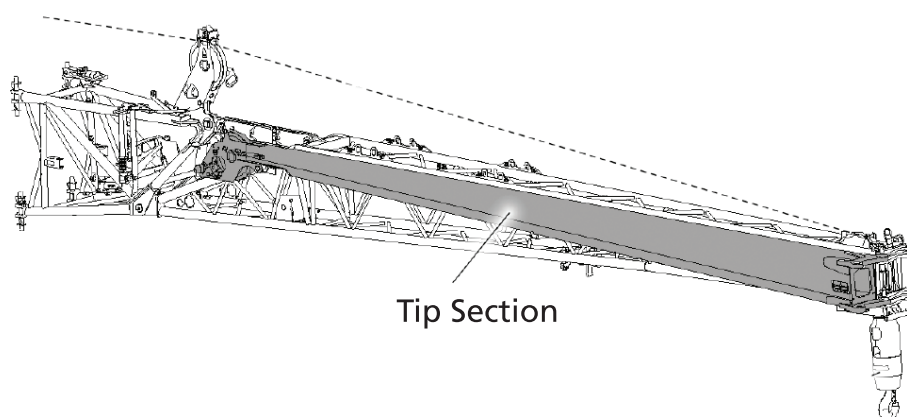

The load was secured to the transporter by a single strap at the front and another single strap at the rear of the Jib. The tip section was secured using only the manufacturers pinning mechanism and components.

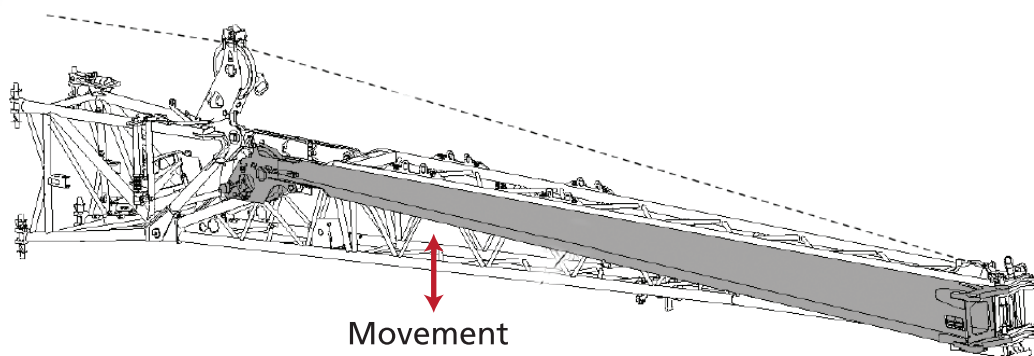

In this transport configuration the tip section is leveraged by its own weight. This combined with the road conditions can place additional pressure on different components. In this event, the movement led to a component failing. The tip section then opened on the transporter into the live traffic lane with the potential to cause serious harm.

### Corrective Actions

1. Secure the tip section directly to the base section to support the tip section from leverage during transport.
2. Ensure securing prevents the tip sections ability to open during transport operations.